


1

LOCATION	CAR PARK L3
SWITCHBOARD	TEE OFF BOX FOR DB 3-1-10
COMPONENT	Fuse White Phase
OBSERVATION	Line Side Connection

Date: 17/01/2006

Time: 1:52:24 PM

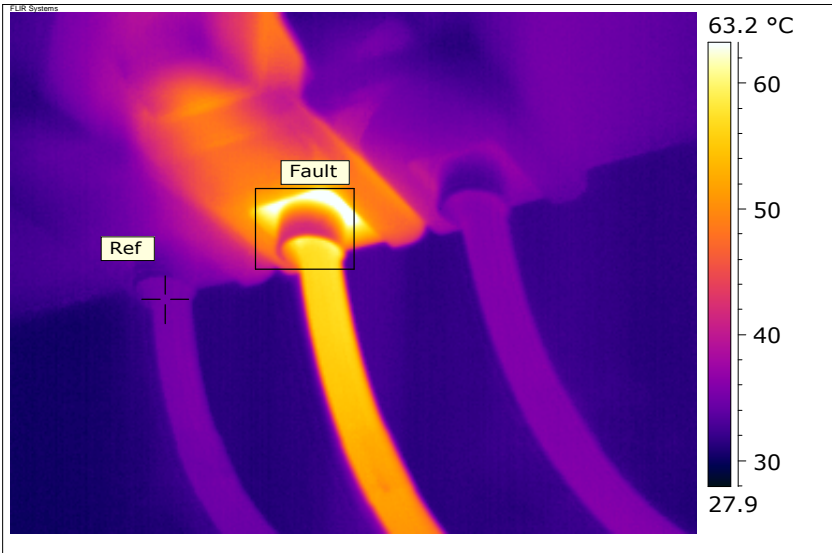

Result Table

Label	Value
Ref	35.1 °C
Fault: Max	69.8 °C
Temp Diff.	34.8

The load was checked to be:

Red Phase	68 amps
White Phase	54 amps
Blue Phase	42 amps



RECOMMENDATIONS

Clean, check and tighten connection, the fuse base and wedge may need to be replaced.

Continue Inspections.

REPAIRERS COMMENTS

Signed: _____ Date: _____